

Hamre, John G.

From: Fahn, Patrick J.
Sent: Wednesday, September 17, 2008 4:34 PM
To: Hamre, John G.
Subject: FW: PSC CASE NUMBER PU-06-421
Attachments: South Spread Report 9-16-08 PU-06-421.pdf

John - please docket in 06-421 and then forward to Commissioners, PUD, and Legal

Patrick Fahn
Utility Analyst
Email: pfahn@nd.gov
Phone: (701) 328-4077

North Dakota Public Service Commission
600 E Boulevard
Bismarck ND 58505-0480
Fax: (701) 328-2410

-----Original Message-----

From: Dave Opdahl [mailto:dave.opdahl@kljeng.com]
Sent: Wednesday, September 17, 2008 4:25 PM
To: Fahn, Patrick J.
Cc: Mark Anderson
Subject: PSC CASE NUMBER PU-06-421

Please call if you have any questions or comments.

Dave

David Opdahl
Engineering Technician
Municipal Group
Kadrmass Lee & Jackson, Inc.
701-845-4980

PSC CASE NUMBER: PU-06-421

Kadmas
Lee &
Jackson
Engineers Surveyors
Planners

DAILY REPORT

Job Site: SOUTH SPREAD

Date: 9-16-08 & 9-17-08

Location and
Operations Observed: MP 130 - 143.2 CLEAN-UP & RESTORATION

MP 147.3 ENVIRONMENTAL

MP 169 EROSION CONTROL / BACKFILL
SHEVENNE RIVER BORE

MP 194 LOWERING / BACKFILL

General Notes: PRIMARY FOCUS OF THIS FIELD
INSPECTION WILL BE THE CLEAN-UP AND
RESTORATION EFFORTS OF MICHAELS.

SAAWN WITTENBERG CONTACTED MARK
ANDERSON AND EXPRESSED CONCERNS
THAT DEBRIS WAS BEING LEFT ON
HIS PROPERTY AND THE PROPERTY OF
HIS RELATIVES.

Kadrmas
Lee &
Jackson
Engineers Surveyors
Planners

DAILY REPORT (Cont.)

9-16-08
Date 9-17-08

Page 2 of 5

MP 130 TO MP 143.2~ SUBSOIL HAS BEEN RIPPED AND TOPSOIL HAS BEEN SPREAD. I STOPPED AT SEVERAL ROAD CROSSINGS AND WALKED THE WIDTH OF THE EASEMENT. THE TOPSOIL APPEARED TO ^{BE} SPREAD UNIFORMLY AND WAS SHAPED TO EXISTING CONTOURS. I SAW VERY LITTLE EVIDENCE OF SUBSOIL. THE TOPSOIL WAS FREE OF LARGE CLODS AND SEEMED MELLOW.

MP 132 TOOK PHOTOS OF A WETLAND AREA ON BOTH SIDES OF 21ST ST SE. SAW EVIDENCE THAT THE WETLANDS WERE RECOVERING FROM CONSTRUCTION ACTIVITY. ALSO NOTED THAT SOME BLADE WORK HAD BEEN DONE TO THE ROAD.

MP 133 TOOK PHOTOS OF 3" ROCK THAT WAS NOT RECOVERED. THIS ROCK WAS HAULED IN AND USED FOR A TEMPORARY ROAD CROSSING. ALSO VISIBLE WAS LEFTOVER CRIBBING WOOD.

MP 133 - 143.2 BRIEFLY INSPECTED EASEMENT FOR CLEAN-UP ISSUES. ROCK USED FOR ROAD CROSSINGS IS NOT CLEANED UP FROM INSLOPES/CROPLAND. PIPE USED FOR TEMPORARY CULVERTS REMAINS AT MP. 143.2

Kadmas
Lee &
Jackson
Engineers Surveyors
Planners

DAILY REPORT (Cont.)

9-16-08
Date 9-17-08Page 3 of 5

MP 147.3 STOPPED & WALKED DITCHES BOUNDING

THE NORTH EDGE OF THE STARKE PROPERTY.

SAW NO EVIDENCE OF SILT OR CLAY DEPOSITS.

THE END OF THE PIPELINE IS EXPOSED AND

IS 1/2 UNDER WATER. THE END IS CAPPED WITH

A PLASTIC COVER & HEAVILY DUCT TAPED.

MP 169 AREA NORTH OF HIELLE PKWY HAS BEEN

BACK-FILLED & RESTORED. A GOOD COVER OF

STRAW HAS BEEN SPREAD OVER DISTURBED AREAS.

(ON THURSDAY, 9-11-08, I DROVE PAST THIS AREA

ON PERSONAL TIME AND OBSERVED THE CONTRACTOR

INSTALLING URETHANE FORM BULKHEADS ROUGHLY

25' ON CENTER DOWN THE STEEP SLOPE TO THE

ROAD. THE CONTRACTOR WAS ALSO BACKFILLING.)

MICHAELS IS BORING UNDER THE SHEYENNE RIVER

AND HAVE REACHED ABOUT 1/2 WAY. INSPECTOR SAID

THAT THE BORE HEAD IS STILL GOING DOWN

TO THE TARGET DEPTH OF 40 FEET.

PSC CASE NUMBER: PU-06-421

Kadmas
Lee &
Jackson
Engineers Surveyors
Planners

DAILY REPORT (Cont.)

9-16-08
Date 9-17-08

Page 4 of 5

MP 194 MICHAELS IS LOWERING AND BACK FILLING
PIPE ROUGHLY 9 MILES BEHIND WELDING &
COATING OPERATION.

MP 203 TO 206 PIPE IS STRUNG-OUT. STOPPED
SEVERAL TIMES TO INSPECT DEPTH OF TOPSOIL
STRIPPING & FOUND NO ISSUES.

PSC CASE NUMBER: PU-06-421

adrmas
Lee &
Jackson
Engineers Surveyors
Planners

DAILY REPORT (Cont.)


9-16-08
Date 9-17-08

Page 5 of 5

The following deviations from the finding of facts were found:

- NONE -

Signature:

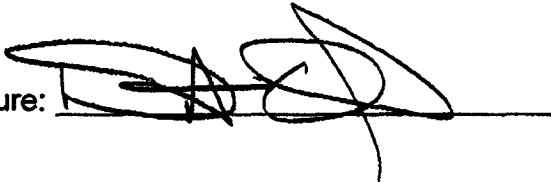

Print Name:

DAVE OPDAHL